

Manhole Inspection Summary

Manhole # S15EE2023MH

Printed On: 12/17/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **15EE2** Node: **023** Status: **Found**

Insp Date: **7/13/06 9:40 AM**

Incomplete Comments

Crew: **JJ, TD**
Inspector: **Jensen, J**
Firm: **RKK**

Location Address: **1919 FAIRBANK RD**

Cross Street: **POPLIN AVE**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **Cracks in pavement around manhole. Possible source of infiltration.**

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0.5** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **2** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☐ Exists

Material:

☐ Parged

Height: (in.)

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☐ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☒ **Deteriorated**

Infiltration: ☐ None

☒ **Joint**

☐ Cracks

☒ **Mortar**

☐ Roots

☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **42** (in.) Length: (in.)

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Loose Brick

☐ Deteriorated

Infiltration: ☒ None

☐ Joint

☐ Cracks

☐ Mortar

☐ Roots

☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Condition: ☒ Sound

☐ Cracked

☐ Root Intrusion

☐ Deteriorated

☐ Leaks

☐ Debris

Channel

Material: **Brick**

☐ Parged

☐ Debris (not Condition related)

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft. Azimuth:

Condition: ☐ Sound

☐ Cracked

☐ Root Intrusion

☒ **Deteriorated**

☐ Leaks

☐ Debris

Steps

Count: **5**

Missing: **0**

☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth: **2**

(ft.)

☐ Active Surcharge Present

Location View



Top View



Bench debris. Corroded steps.

Defect



Frame leaks. Corbel deterioration and infiltration.

Defect



Frame offset. Corbel infiltration.

Defect



Bench debris.

Manhole Inspection Summary

Manhole # S15EE2023MH

Printed On: 12/17/2008

Page 3 of 4

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **9.98** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

4 in. Circular Gravity Sewer Pipe In @ 2 O'Clock



Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **8.04** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

Manhole Inspection Summary


Manhole # S15EE2023MH

Printed On: 12/17/2008


Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock

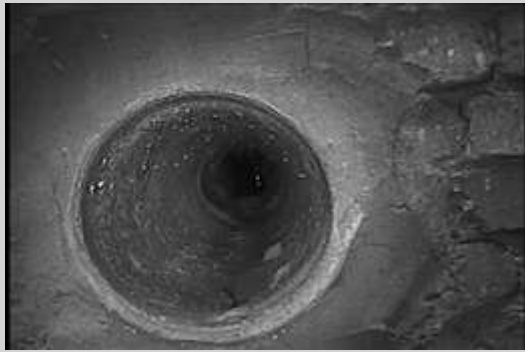

Drop In @ 6 O'Clock

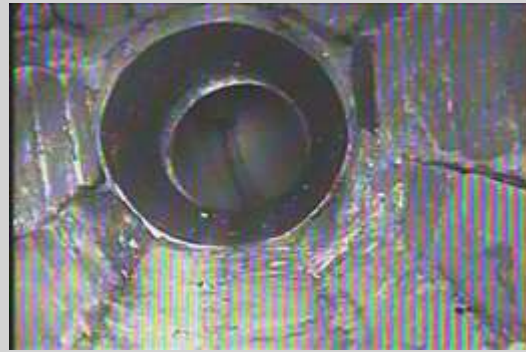

Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **6.58** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Unknown**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **8.62** (ft.)

Inv Depth: **9.62** (ft.)

Drop Condition: **Open**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **9.71** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection